




Round Hole Screens

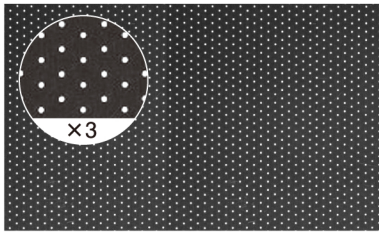


No.	Hole Size	Hole Center	□*
P1	0.20	1.09	650.0
	Open Area	Hole Pattern	Max. Width
	3.1%	60° staggered	230

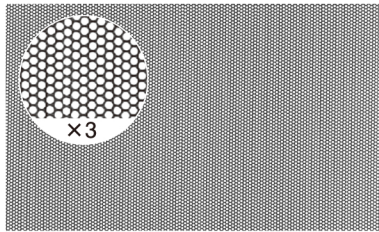


No.	Hole Size	Hole Center	□*
P2 (N2)	0.25	0.43	4055.0
	Open Area	Hole Pattern	Max. Width
	30.7%	60° staggered	200

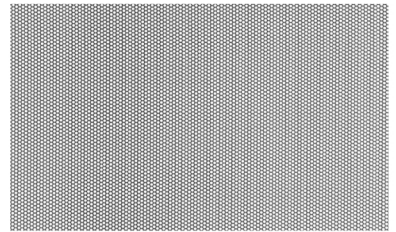


No.	Hole Size	Hole Center	□*
P4 (N4)	0.30	0.50	3000.0
	Open Area	Hole Pattern	Max. Width
	32.8%	60° staggered	230

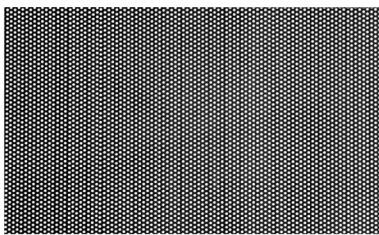


No.	Hole Size	Hole Center	□*
P5	0.30	0.60	2067.0
	Open Area	Hole Pattern	Max. Width
	22.7%	60° staggered	230

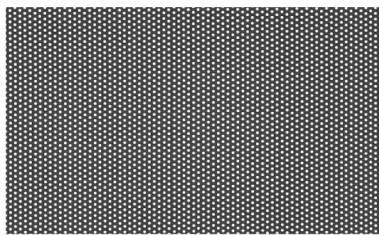


No.	Hole Size	Hole Center	□*
P7 (N3)	0.30	0.75	1320.0
	Open Area	Hole Pattern	Max. Width
	14.5%	60° staggered	230

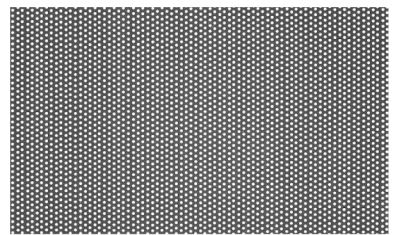


No.	Hole Size	Hole Center	□*
P8 (N6)	0.35	0.75	1320.0
	Open Area	Hole Pattern	Max. Width
	19.7%	60° staggered	400

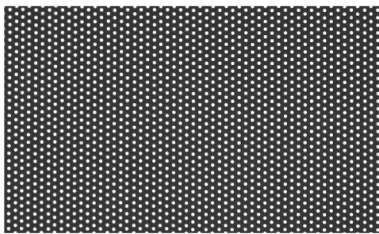


No.	Hole Size	Hole Center	□*
P9 (N5)	0.35	1.05	670.0
	Open Area	Hole Pattern	Max. Width
	10.0%	60° staggered	500

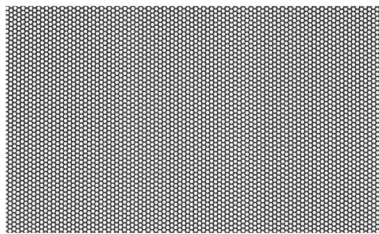


No.	Hole Size	Hole Center	□*
P10 (N9)	0.40	0.60	2067.0
	Open Area	Hole Pattern	Max. Width
	40.2%	60° staggered	200

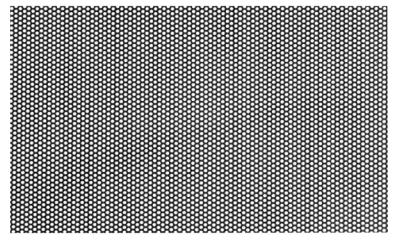


No.	Hole Size	Hole Center	□*
P11	0.40	0.65	1763.0
	Open Area	Hole Pattern	Max. Width
	34.3%	60° staggered	610

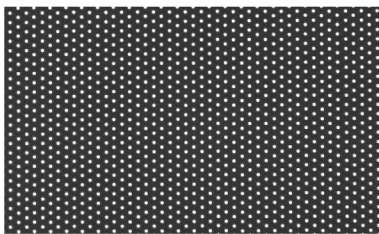


No.	Hole Size	Hole Center	□*
P14 (N7)	0.40	1.22	516.0
	Open Area	Hole Pattern	Max. Width
	10.0%	60° staggered	1000

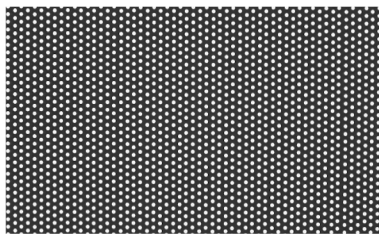


No.	Hole Size	Hole Center	□*
P15 (N10)	0.45	1.00	740.0
	Open Area	Hole Pattern	Max. Width
	18.2%	60° staggered	1000

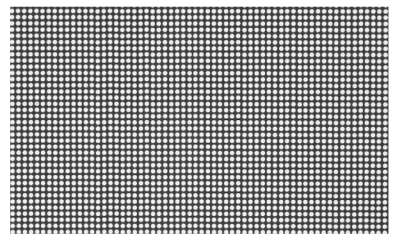


No.	Hole Size	Hole Center	□*
P16 (N14)	0.50	0.80	1010.0
	Open Area	Hole Pattern	Max. Width
	30.7%	90° straight	400

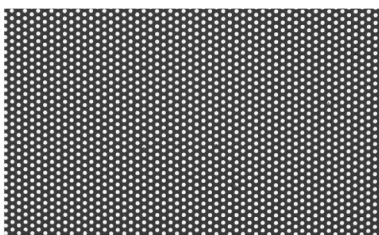


No.	Hole Size	Hole Center	□*
P18 (N13)	0.50	1.00	740.0
	Open Area	Hole Pattern	Max. Width
	22.6%	60° staggered	1000

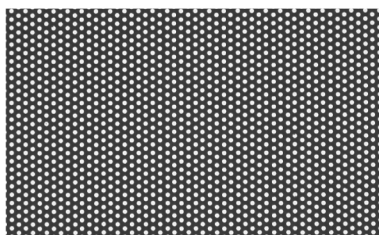


No.	Hole Size	Hole Center	□*
P19 (N12)	0.50	1.09	625.0
	Open Area	Hole Pattern	Max. Width
	19.0%	60° staggered	1000

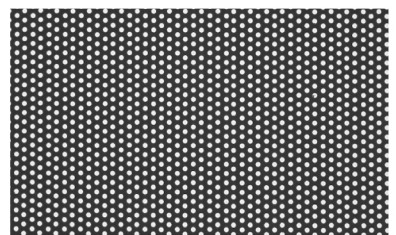


No.	Hole Size	Hole Center	□*
P24 (N19)	0.60	1.21	502.0
	Open Area	Hole Pattern	Max. Width
	22.0%	60° staggered	1000

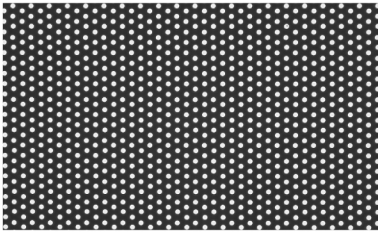


No.	Hole Size	Hole Center	□"
P26 (N17)	0.60	1.45	362.0
	Open Area 15.9%	Hole Pattern 60° staggered	Max. Width 1000

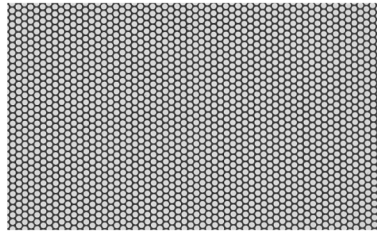


No.	Hole Size	Hole Center	□"
P27 (N22)	0.70	0.93	861.7
	Open Area 51.4%	Hole Pattern 60° staggered	Max. Width 100

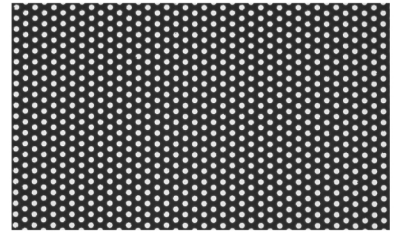


No.	Hole Size	Hole Center	□"
P28 (N21)	0.70	1.43	363.0
	Open Area 21.6%	Hole Pattern 60° staggered	Max. Width 610

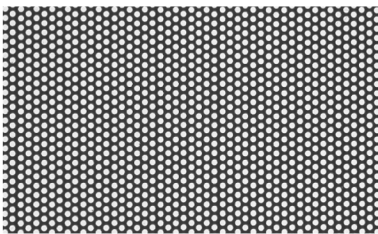


No.	Hole Size	Hole Center	□"
P30 (N23)	0.75	1.19	525.0
	Open Area 35.9%	Hole Pattern 60° staggered	Max. Width 1000

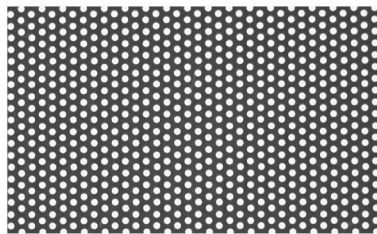


No.	Hole Size	Hole Center	□"
P34 (N25)	0.80	1.50	330.8
	Open Area 25.8%	Hole Pattern 60° staggered	Max. Width 1000

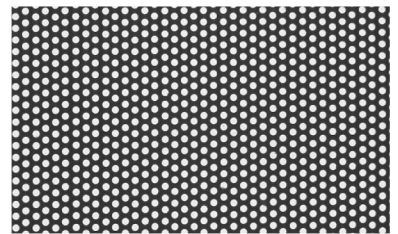


No.	Hole Size	Hole Center	□"
P37 (N29)	0.90	1.50	330.8
	Open Area 32.6%	Hole Pattern 60° staggered	Max. Width 1000

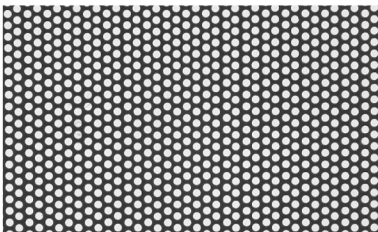


No.	Hole Size	Hole Center	□"
P40 (N34)	1.00	1.50	330.8
	Open Area 40.3%	Hole Pattern 60° staggered	Max. Width 1000

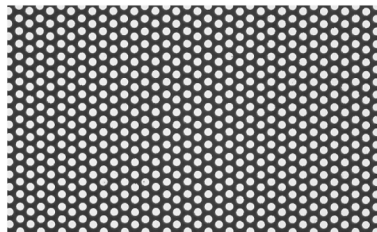


No.	Hole Size	Hole Center	□"
P41 (N33)	1.00	1.60	291.0
	Open Area 35.4%	Hole Pattern 60° staggered	Max. Width 1000

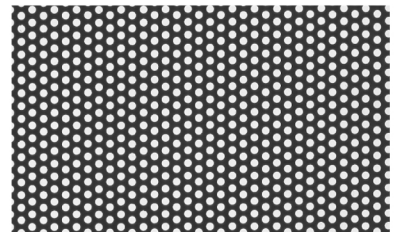


No.	Hole Size	Hole Center	□"
P42 (N32)	1.00	1.70	257.8
	Open Area 31.4%	Hole Pattern 60° staggered	Max. Width 1000

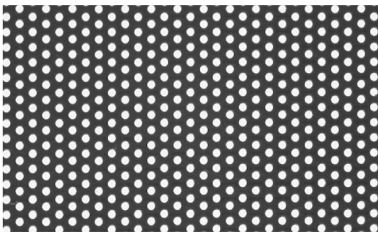


No.	Hole Size	Hole Center	□"
P43 (N30)	1.00	2.00	186.0
	Open Area 22.6%	Hole Pattern 60° staggered	Max. Width 1000

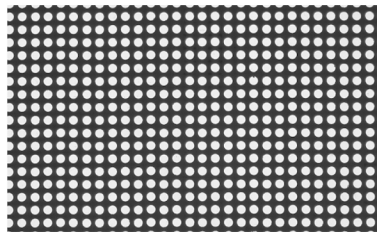


No.	Hole Size	Hole Center	□"
P45 (N36)	1.14	1.70	223.0
	Open Area 35.3%	Hole Pattern 90° straight	Max. Width 1000

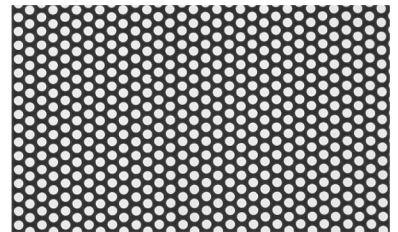


No.	Hole Size	Hole Center	□"
P47 (N40)	1.20	1.80	231.0
	Open Area 40.4%	Hole Pattern 60° staggered	Max. Width 1000

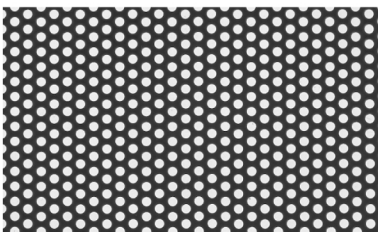

No.	Hole Size	Hole Center	□"
P48 (N39)	1.20	2.00	186.0
	Open Area 32.6%	Hole Pattern 60° staggered	Max. Width 1000

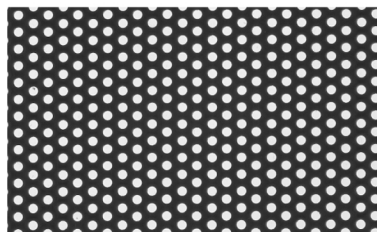


No.	Hole Size	Hole Center	□"
P49 (N38)	1.20	2.25	147.0
	Open Area 25.8%	Hole Pattern 60° staggered	Max. Width 1000

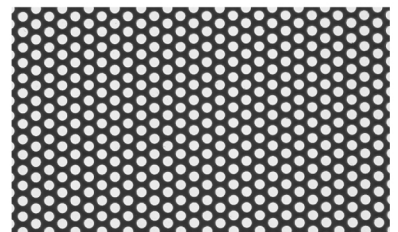


No.	Hole Size	Hole Center	□"
P51 (N41)	1.30	2.00	186.0
	Open Area 38.3%	Hole Pattern 60° staggered	Max. Width 400


Round Hole Screens

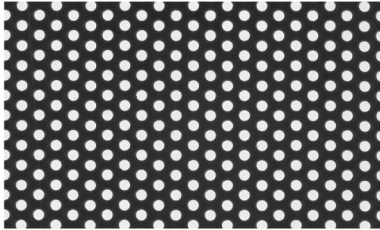


No.	Hole Size	Hole Center	□*
P53 (N42)	1.40	2.60	110.3
	Open Area 26.3%	Hole Pattern 60° staggered	Max. Width 230

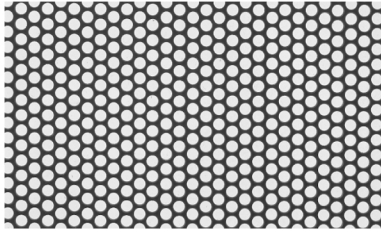


No.	Hole Size	Hole Center	□*
P54 (N46)	1.50	2.00	186.0
	Open Area 50.9%	Hole Pattern 60° staggered	Max. Width 1000

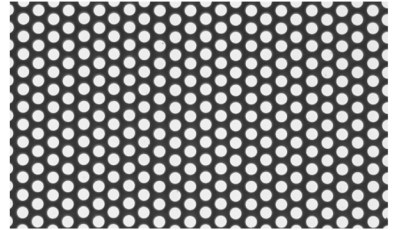


No.	Hole Size	Hole Center	□*
P55 (N45)	1.50	2.25	147.0
	Open Area 40.0%	Hole Pattern 60° staggered	Max. Width 1000

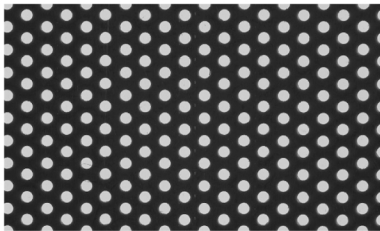


No.	Hole Size	Hole Center	□*
P57 (N43)	1.50	3.00	82.0
	Open Area 22.4%	Hole Pattern 60° staggered	Max. Width 1000

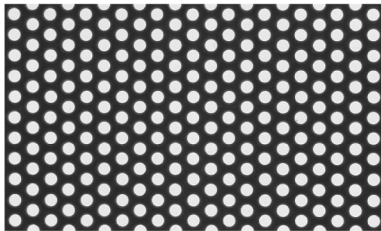


No.	Hole Size	Hole Center	□*
P58 (N47)	1.60	2.72	100.0
	Open Area 31.2%	Hole Pattern 60° staggered	Max. Width 1000

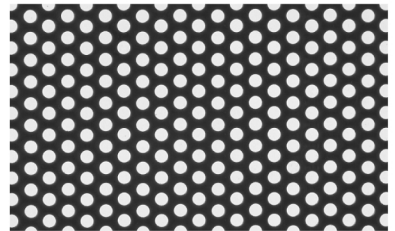


No.	Hole Size	Hole Center	□*
P61 (N48)	1.70	2.85	92.0
	Open Area 32.4%	Hole Pattern 60° staggered	Max. Width 610

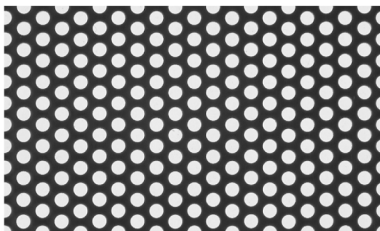


No.	Hole Size	Hole Center	□*
P62 (N49)	1.80	2.85	92.0
	Open Area 36.3%	Hole Pattern 60° staggered	Max. Width 610

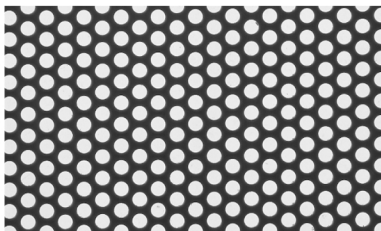


No.	Hole Size	Hole Center	□*
P63 (N50)	1.90	2.85	92.0
	Open Area 40.4%	Hole Pattern 60° staggered	Max. Width 230

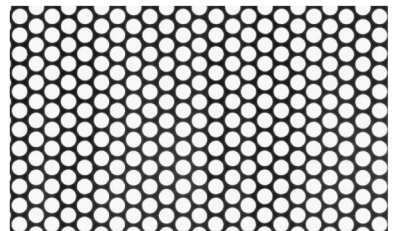

No.	Hole Size	Hole Center	□*
P64	2.00	2.50	119.2
	Open Area 58.0%	Hole Pattern 60° staggered	Max. Width 400

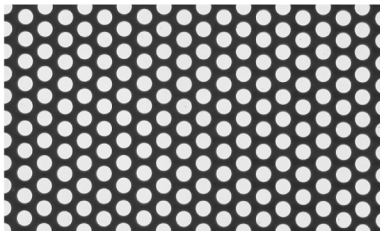

No.	Hole Size	Hole Center	□*
P65 (N52)	2.00	3.00	82.0
	Open Area 39.9%	Hole Pattern 60° staggered	Max. Width 1000

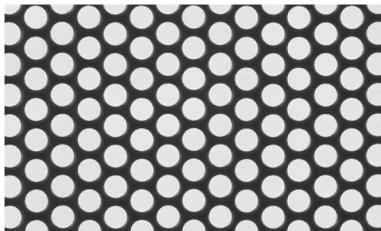

No.	Hole Size	Hole Center	□*
P70 (N54)	3.00	4.00	46.6
	Open Area 51.3%	Hole Pattern 60° staggered	Max. Width 1000